 



# Compression Cable Assembly Instructions

1. Cut cable to length
2. Trim cable using coax cable stripper




3. Fold braid back over vinyl shield, trim center conductor to 3/8" long and the white insulation to 1/8" long

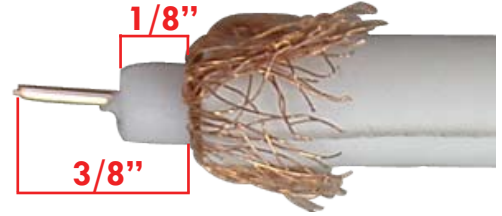


4. Insert the cable into the compression fitting and make sure the center conductor goes into the center pin




5. Make sure to push the fitting onto the cable enough so that the center pin is fully exposed

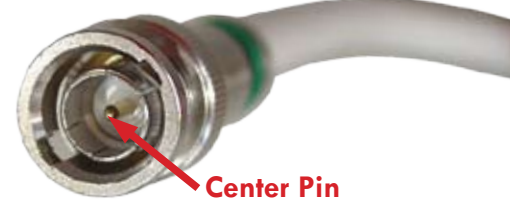

6. Place the cable into the crimper as shown and close the cable guide

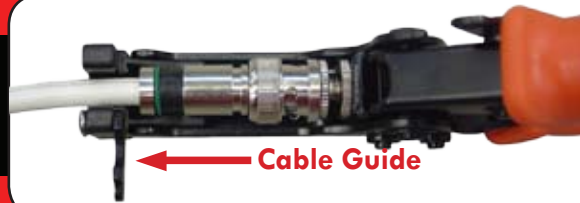

7. Crimp until you hear two clicks and the black rubber gasket is compressed to show only the green colored ring

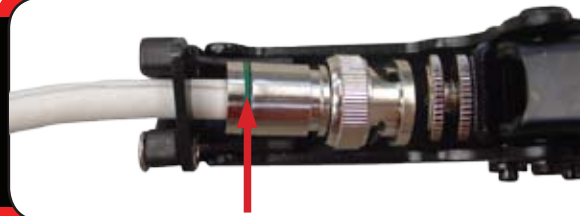

8. Repeat for all coax compression fittings

